ENGINE LOG

License Number

EITOILE	-04	~)
/		ö	
Engine Log Entry N13DK	MA	3607 c ok.	3ignature
9-10-2011 1441.71TT 239.95 TSN	-	⊆_ ∞ ≾	
Removed right magneto P/N 6350 S/N 95080024 Installant		S/N S/N S/N S/N S/N S/N	
the later S/N magneto required the drive gear to be re-		NOC SN SN SN SN SN SN SN SN SN SN SN SN SN	
locked in order for the magneto to be installed in the		S/N S/9T 3350 1 63 S/1 63 Ing	
offection offentation. During the drive gear removal the		79.7 P/N 6.7 20m 30m	
support bearing came with the gear. Removal of the engine was required to ensure the correct reinstallation of the		13.1 9.5 9.7 9.7 9.7 9.7 9.7	
caring. The engine was removed and reinstalled IAW E-		AW AW	-
recommendations Chap. / 1 & 72 Magneto replacement		itry aggr ind ind er II	
vas done IAW Lycoming service instructions. Serviced ngine with oil and replaced oil filter P/N CH48108-1.		Er H H H H H H H H H H H H H H H H H H H	-
round run and leak check was satisfactory.		S A S A)
troucks to Kinds		Z d la	4
troube W. Lander II	Α	ine 5-2 5-2 love love love love love love love love	Orsement of a
877274IA	C€ C€	1-2 1-2 108 108 108	ng and
		шока≒:⊑Жұ	~~~~